QUALITY VALUED. CONFIDENCE DELIVERED

Service	Pre-shipment Inspection			
Report No.	V-2312158			
Date Issued	2023-12-20	P 1 / 15		

#### INSPECTION REPORT

1. INSPECTION I	NFORMATION	
Client:	EWHEELS LLC	
Supplier:	Begode	
Factory:	Begode	
Product:	Unicycles	
P.O. No.:	-	
P.O. Quantity:	30sets	
Item No.:	T4 Pro	
Inspection Date:	2023/12/19	
Location:	Dongguan City, Guangdong Province	
Inspector:	Henry Xiao	

2. INSPECTION RESULT				
Category	Conform	Not Conform	Pending	Check Points
Workmanship/Function	$\checkmark$			

OVERALL CONCLUSION	CONFORM
	Approved by: Sunny Cai

#### 3. REMARK POINT

#### NOTE

- Upon arrival, only 30sets were finished and under packing. And before left factory, only 4set were finished and packed into cartons without sealed and shipping mark didn't stuck yet, the rest were finished and under packing.
- 2 No assembling instruction manual was packed into packaging.

#### **Check Points (Patton)**

1) Battery voltage to full: Ensure that all the Unicycles can reach (100.8V)+/-0.5V when it was fully charged, and check another 3 samples to verify the discrepancy between the data on multimeter and the data shown on the screen of app.

Result: 20 out of 30pcs inspected samples were found that the battery voltage shown on App did not reach 100.8v +/- 0.5V.

**QUALITY VALUED. CONFIDENCE DELIVERED** 

 Service
 Pre-shipment Inspection

 Report No.
 V-2312158

 Date Issued
 2023-12-20
 P 2 / 15





Battery voltage check By App:

Battery voltage check By App:






Battery voltage check By App:

Battery voltage check



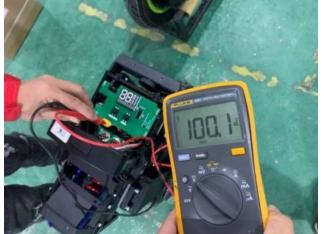

Battery voltage check

Actual Checked:	100.1	100.1	100.1			
By App:	100.6	100.0	100.3			

Battery Voltage check by App

QUALITY VALUED. CONFIDENCE DELIVERED

Service	Pre-shipment Inspection			
Report No.	V-2312158			
Date Issued	2023-12-20	P 3 / 15		

100.1	100.1	100.1	100.3	100.8	100.5	100.4	100.6	100	100
99.9	100	100.2	100.5	100.1	99.7	100	99.8	99.8	99.9
99.8	100.6	100.6	100.6	99.8	100	99.7	100.5	100.1	100.2

Besides the normal checks of voltage, App connectivity, the main thing that we need to check here is motor scraping noises. Of a limited production run of just 10pcs last time, 4x of them had this scraping noise problem. Levi claims it's the tire coming into contact with the fender, but there's no evidence of this, some Customers even removed the fender with the same result.

Result: Conform



Nil

Connectivity to the App.

Result: Conform



Nil

We've had 3x reports of the handle just coming out from the slot, the factory didn't bother to screw the handles

into the body properly.

Result: Conform

- Tire wobble

5

7

Result: Conform

abnormal motor/tire noise in rotation

Result: Conform

Motor rotation: there is minimum wire oscillation/wobbling in rotation.

Result: Conform

**QUALITY VALUED. CONFIDENCE DELIVERED** 

Service	Pre-shipment Inspection		
Report No.	V-2312158		
Date Issued	2023-12-20	P 4 / 15	

Bearing abnormity:

Result: Conform
All lights work

Result: Conform





**QUALITY VALUED. CONFIDENCE DELIVERED** 

Service	Pre-shipment Inspection		
Report No.	No. V-2312158		
Date Issued	2023-12-20	P 5 / 15	

#### PHOTO ATTACHMENT

#### 0 Other





1 Factory gate

2 Packing view

Nil




3 Finished products

Nil

#### 1 ITEM



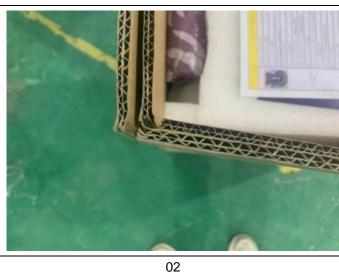


**QUALITY VALUED. CONFIDENCE DELIVERED** 

 Service
 Pre-shipment Inspection

 Report No.
 V-2312158

 Date Issued
 2023-12-20
 P 6 / 15

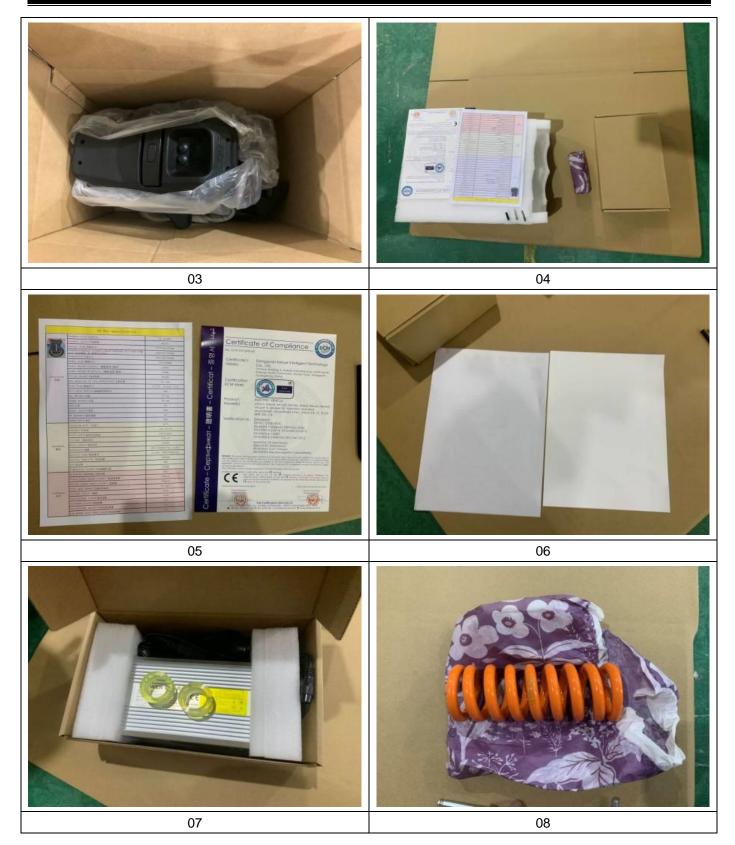


**QUALITY VALUED. CONFIDENCE DELIVERED** 

Service Pre-shipment Inspection

Report No. V-2312158

Date Issued 2023-12-20 P 7 / 15

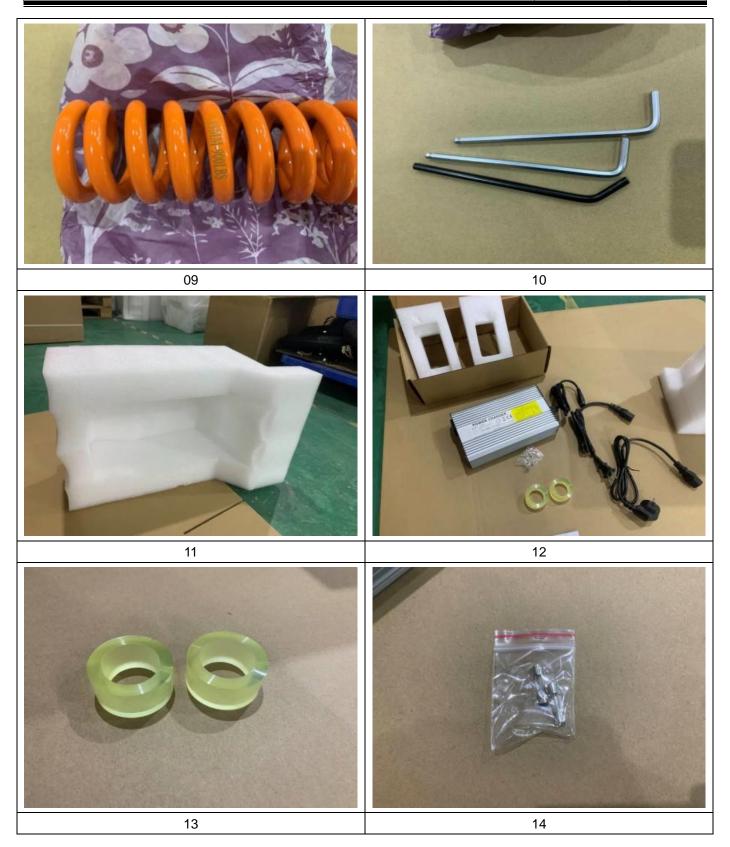

**QUALITY VALUED. CONFIDENCE DELIVERED** 

 Service
 Pre-shipment Inspection

 Report No.
 V-2312158

 Date Issued
 2023-12-20
 P 8 / 15



**QUALITY VALUED. CONFIDENCE DELIVERED** 

Service Pre-shipment Inspection

Report No. V-2312158

Date Issued 2023-12-20 P 9 / 15




**QUALITY VALUED. CONFIDENCE DELIVERED** 

Service Pre-shipment Inspection

Report No. V-2312158

Date Issued 2023-12-20 P 10 / 15

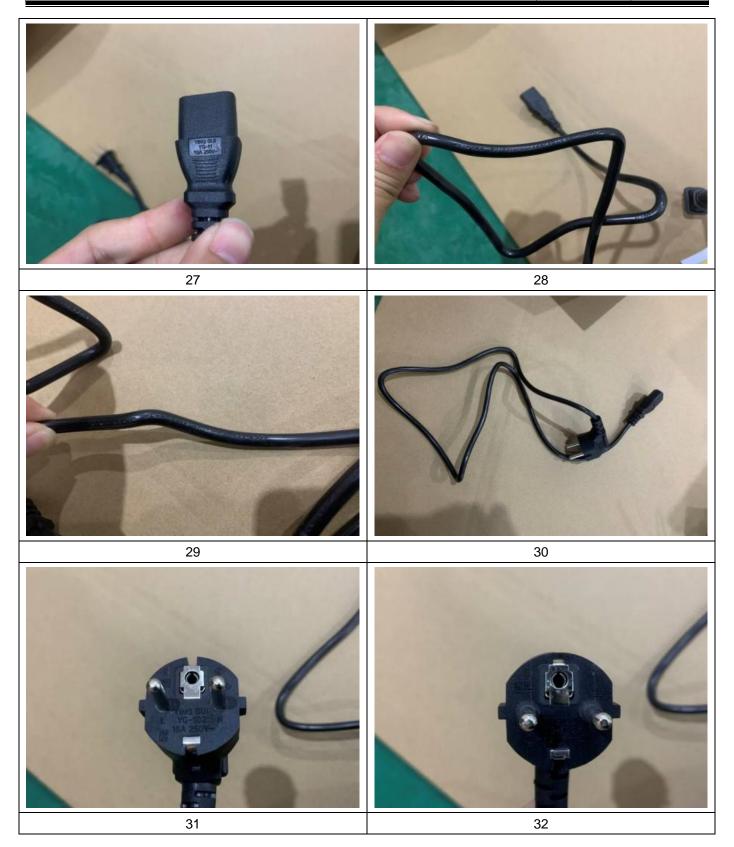


**QUALITY VALUED. CONFIDENCE DELIVERED** 

Service Pre-shipment Inspection

Report No. V-2312158

Date Issued 2023-12-20 P 11 / 15

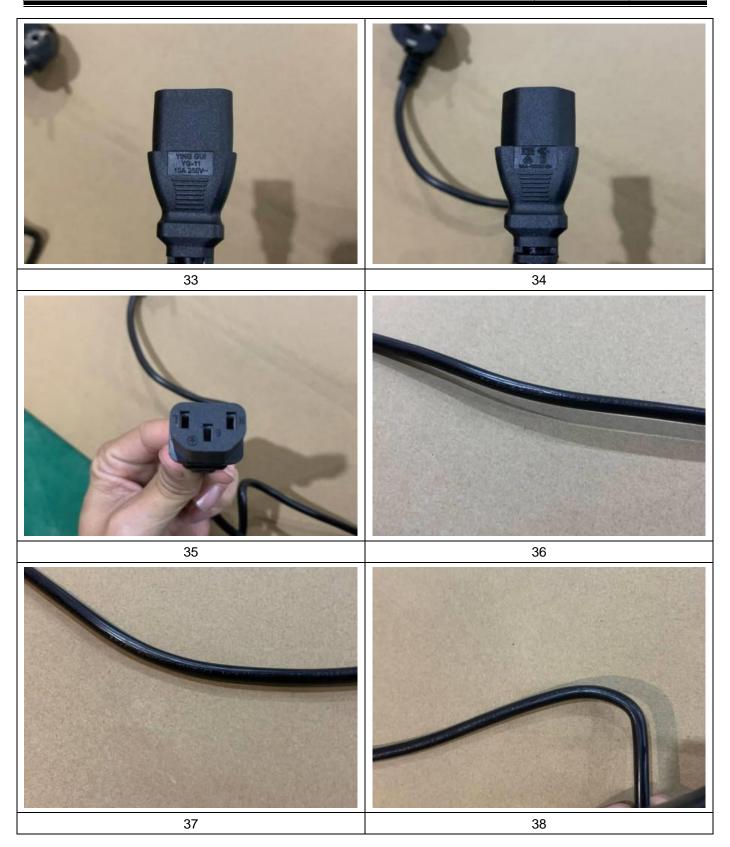


**QUALITY VALUED. CONFIDENCE DELIVERED** 

 Service
 Pre-shipment Inspection

 Report No.
 V-2312158

 Date Issued
 2023-12-20
 P 12 / 15

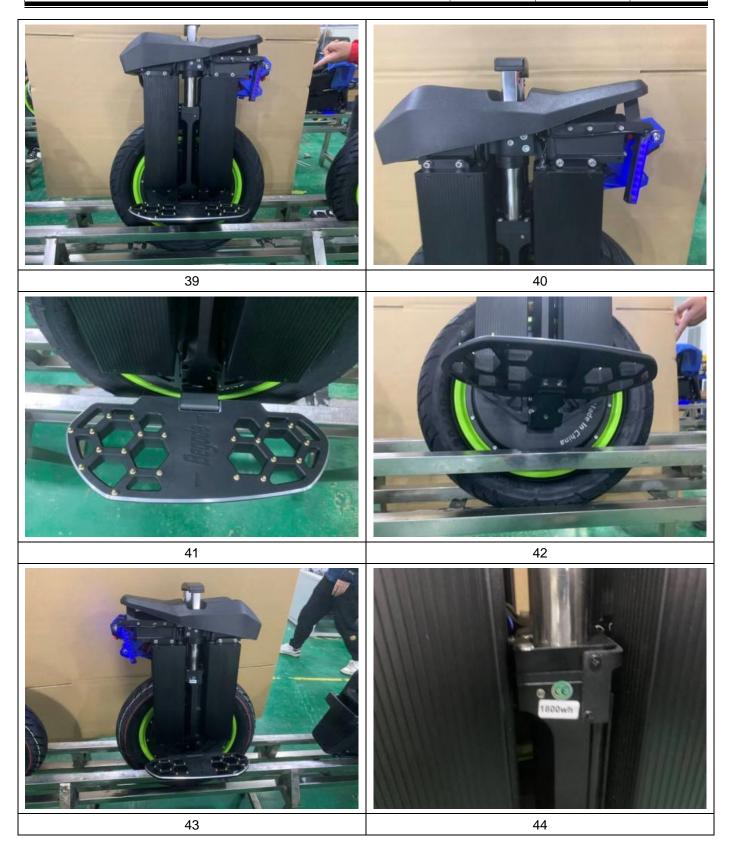

**QUALITY VALUED. CONFIDENCE DELIVERED** 

Service Pre-shipment Inspection

Report No. V-2312158

Date Issued 2023-12-20 P 13 / 15



**QUALITY VALUED. CONFIDENCE DELIVERED** 

Service Pre-shipment Inspection

Report No. V-2312158

Date Issued 2023-12-20 P 14 / 15



**QUALITY VALUED. CONFIDENCE DELIVERED** 

Service Pre-shipment Inspection

Report No. V-2312158

Date Issued 2023-12-20 P 15 / 15

